


F23

TAPER CUT REINFORCEMENT

Restores full shear & reaction capacity

Note:

BLI joist not to act as rafter tension tie.

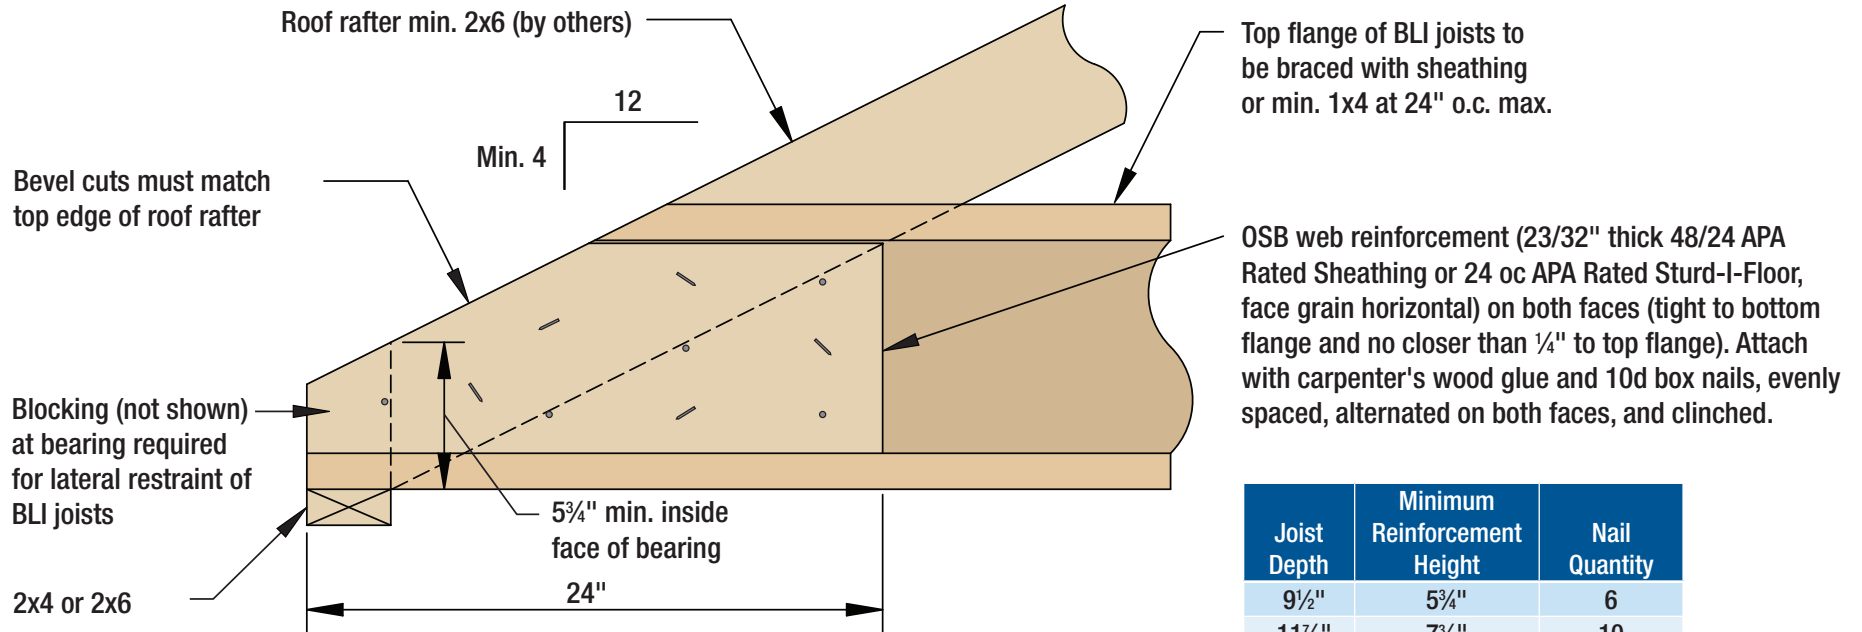

Joist Depth	Minimum Reinforcement Height	Nail Quantity
9 1/2"	5 3/4"	6
11 7/8"	7 3/4"	10
14"	9 1/4"	12
16"	11 3/4"	14
18"	14"	18